


表1 各部寸法

呼び Rc1×Rc2×Rc3×Rc4		Rc a	Rc b	Rc c	Rc d	中心から端面までの距離			
B	A					A	B	C	D
1×3/4×3/4×3/4	25×20×20×20	Rc1	Rc3/4	Rc3/4	Rc3/4	34	32	35	35
1×1×3/4×3/4	25×25×20×20	Rc1	Rc1	Rc3/4	Rc3/4	34	34	35	35
11/4×1×3/4×3/4	32×25×20×20	Rc11/4	Rc1	Rc3/4	Rc3/4	37	34	40	40
11/4×1×1×3/4	32×25×25×20	Rc11/4	Rc1	Rc1	Rc3/4	40	38	42	40
11/4×11/4×3/4×3/4	32×32×20×20	Rc11/4	Rc11/4	Rc3/4	Rc3/4	38	38	40	40
11/2×1×3/4×3/4	40×25×20×20	Rc11/2	Rc1	Rc3/4	Rc3/4	38	34	43	43
11/2×1×1×3/4	40×25×25×20	Rc11/2	Rc1	Rc1	Rc3/4	39	37	45	43
11/2×11/4×3/4×3/4	40×32×20×20	Rc11/2	Rc11/4	Rc3/4	Rc3/4	38	38	43	43
11/2×11/4×1×3/4	40×32×25×20	Rc11/2	Rc11/4	Rc1	Rc3/4	41	40	45	43
11/2×11/2×3/4×3/4	40×40×20×20	Rc11/2	Rc11/2	Rc3/4	Rc3/4	38	38	43	43
2×11/2×3/4×3/4	50×40×20×20	Rc2	Rc11/2	Rc3/4	Rc3/4	41	38	49	49
11/2×1×1×1	40×25×25×25	Rc11/2	Rc1	Rc1	Rc1	41	38	45	45
11/2×11/2×1×1	40×40×25×25	Rc11/2	Rc11/2	Rc1	Rc1	41	41	45	45
2×11/4×1×1	50×32×25×25	Rc2	Rc11/4	Rc1	Rc1	44	40	51	51
2×11/2×1×1	50×40×25×25	Rc2	Rc11/2	Rc1	Rc1	44	41	51	51
2×2×1×1	50×50×25×25	Rc2	Rc2	Rc1	Rc1	44	44	51	51
2×2×11/2×11/2	50×50×40×40	Rc2	Rc2	Rc11/2	Rc11/2	52	52	55	55
21/2×2×1×1	65×50×25×25	Rc21/2	Rc2	Rc1	Rc1	48	44	60	60
21/2×21/2×1×1	65×65×25×25	Rc21/2	Rc21/2	Rc1	Rc1	48	48	60	60
21/2×21/2×2×2	65×65×50×50	Rc21/2	Rc21/2	Rc2	Rc2	60	60	65	65

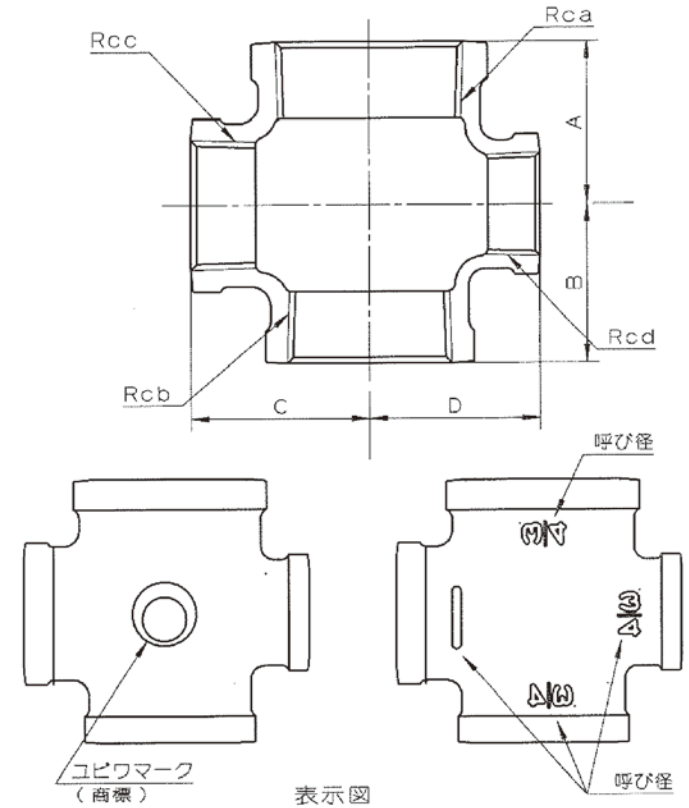

・注1: Rcねじの詳細は、JIS B 0203による。

品番	継手本体	数量	FCMB275-5	備考
寸法	1~21/2 ^φ	日本継手株式会社		
名称	縁付径違いクロス	略号	BRCR	
図名	ねじ込み式可鍛鉄製管継手 (JIS継手)	図番	H-0036	改訂 1 2019.12.11